

BERNINA Firmware Release

BERNINA 7- series


V 32.43.10

Steckborn, 25th October 2012

With the latest firmware for the BERNINA 7- series following issues have been optimized:

Initial situation

Update of the release firmware on Version 32.43.10
B 780:

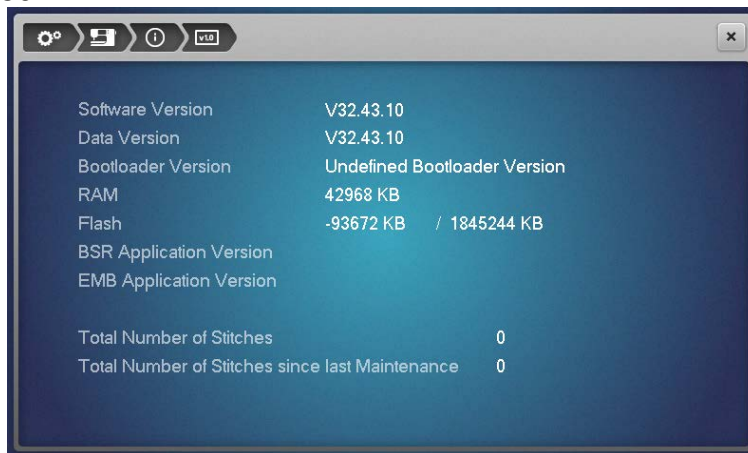

B 710/ 750QE:



- 1.) Unexpected machine stop
The machine stop in sewing and embroidery mode has been corrected.

- 2.) Thread tension for stitches 1+2
The thread tension for the straight and zig-zag stitch (stitches 1+2) has been optimized.

- 3.) NEW
A “sidestep” has been integrated in the thread cutter which is activated automatically after having completed the sewing function. The thread cutter performs a sideways step (below 1.0mm) to the left to avoid a thread cluster on the wrong side of the fabric.

- 4.) Flickering screens at B710 or B750
in case of flickering displays, the new firm ware helps. The clock rate has been increased to control the LCD-tolerances.

Kind regards

BERNINA International AG
Steckborn